


## **IDAutomation SC5USB-D: Enable Codabar**

### **1. Scan the Program Barcode**



### **2. Scan the Read Barcode**

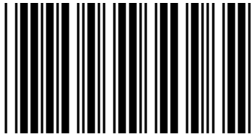

### **3. To enable Codabar scan 0, 1 (or to disable Codabar scan 0,0)**



### **4. Scan Finish Barcode**



### **5. Scan the Exit Barcode**

