

## **IDAutomation SC5USB-D: Enable TAB as Suffix (Tab after Barcode)**

### **1. Scan the Program Barcode**




### **2. Scan the Suffix Barcode**



### **3. To enable the TAB scan 0, 9 (or to disable TAB and set RETURN scan 0,D)**



### **4. Scan Finish Barcode**

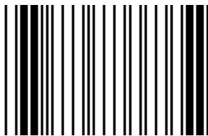

### **5. Scan the Exit Barcode**

